



TELMA RETARDER, INC.

Tel: (847) 593-1098 • Fax: (847) 593-3592
www.TelmaUSA.com

TL106020a

Revised: 1-12-23 AZ

New Hand Control Switch


Products Affected: JL200304, JL210304, TIG31073, and TIG31074

Telma is committed to a philosophy of continuous improvement as a way of enhancing the end-user's experience with our product.


The connector on Telma standard hand control switches JL200304 (3 stages) and JL210304 (4 stages) equipped with RKG connector have been updated to a Deutsch DTM style connector. The RKG type connector is no longer produced.

The new hand control switch part numbers are JL1002529 for the 3-stage switch and JL1002530 for the 4-stage switch. In addition, a new hand control extension harness part number TID31021 is available with Deutsch DTM style mating connector.

As before, the new switch is supplied with the mating connector and terminals in case an older switch with RKG connector needs to be replaced. Wire position details are below.

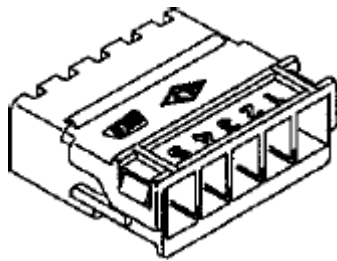

RKG

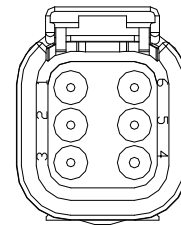

DEUTSCH DTM
STYLE

RKG 5 pin connector position	Deutsch DTM Style Connector position	Function	Telma harness wire color	Hand Control Color
1	1	stage 1	orange	yellow
2	2	stage 2	blue	black
3	3	stage 3	yellow	brown
4	4	stage 4	brown	red
-	5	-	-	blue
5	6	common input	black	white

For questions email engineering@telmacse.com or call 847 593-1098 option 4.

Please forward to all applicable users

This document is the exclusive property of TELMA RETARDER INC. It cannot be copied, modified, forwarded, or given to any third party without prior agreement from TELMA RETARDER INC. Any infringement will immediately involve legal action.